

Work Order ID 132129

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 1

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 4/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/8/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: mf Date: 132129 Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3391	I								

100

0.00

100

Skidtubes

Skidtubes

Skidtubes

Memo

0.02

1-Cut tube to finish length as per Dwg D3391

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

3-Open saddles and GHW holes to Ø0.4375" except for fwd saddle hole of detail "J"

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391

5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391



6-Deburr

7- Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

8- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 using drill press.

ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per

ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499".

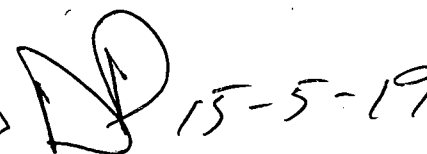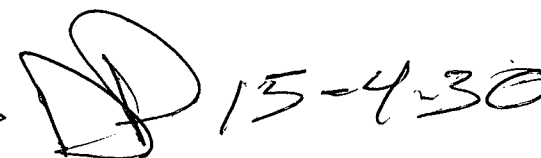D3391-021 BATCH: 132124

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			

Work Order ID 132129

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 2

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 4/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/8/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	9- Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker, ***DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (10 holes) as per Dwg D3391 Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391 ***DO NOT OPEN 2 MOST FWD WEARPLATE HOLES*** Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end. 10- Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplate holes in D3391-021 using DT8937 11- Open 10 wearplate holes in D3391-021 to 0.297" dia.								
110	QC5- Inspect part completeness to step on W/O	0.00							
110									
QC	Memo	0.00							
Quality Control									

15-5-21

DAS
38
9-89
MAY 22 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 3

N900040100

Setup Start *NS1*

Stop *NS2*

Cust Item ID:

*** 1 ***

1

Customer:

Reference:

Run Start *NR1*

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

Chemical Conversion Coat per QSI005 4.1

0.00

120

Memo

0.00

Hand Finishing

130

QC7-Inspect Chemical Conversion Coat

0.00

130

Memo

0.00

QC

Quality Control.

DAS
18
8-88

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																		
Large Fab ☐	Composite ☐	Supplier ☐																			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																	
Description Work Order Deviation		Disposition		Completed By																	
				Lead hand / Supervisor Approval Verification																	
				QC / QA Coordinator Approval																	
<table style="width:100%; border: none;"> <tr> <td style="width:25%; vertical-align: top;"> Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ </td> <td style="width:25%; vertical-align: top;"> No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐ </td> <td style="width:25%; vertical-align: top;"> Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ </td> <td style="width:25%; vertical-align: top;"> FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ </td> <td style="width:25%; vertical-align: top;"> Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ </td> <td style="width:25%; vertical-align: top;"> Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐ </td> </tr> </table>					Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐											
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																
OTHER : ☐																					

Work Order ID 132129

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 4

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 4/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/8/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	Skidtubes	0.00							
140									
Skidtubes	Memo	0.01							
Skidtubes	1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: <u>15-10-21</u> batch#: <u>131574</u> NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE								
150	QC5- Inspect part completeness to step on W/O	0.00							
150									
QC	Memo	0.00							
Quality Control									

DAS
18
9-29

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																		
Large Fab ☐	Composite ☐	Supplier ☐																			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																	
Description Work Order Deviation			Disposition																		
						Completed By															
						Lead hand / Supervisor Approval Verification															
			QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																
OTHER :																					

Work Order ID 132129

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 5

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 4/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/8/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 *160* Skidtubes	Skidtubes	0.00				1	0	<i>BE</i> 15-05-28	
Skidtubes	Memo 1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush	0.01	<i>R/R M127865</i>						
170 *170* QC	QC10- Inspect visual per QSI004- ground welds	0.00				1			DAS 38 9-89
Quality Control	Memo	0.00							15-06-05
180 *180* QC	QC5- Inspect part completeness to step on W/O	0.00				1			DAS 38 9-89
Quality Control	Memo	0.00							15-06-05

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER :																			

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 6

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 4/28/2015 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 5/8/2015 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Run Start *NR1*

Approvals: _____ **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Pressure Wash per QSI005 4.3

0.00

185

0.01

HandFinish

Memo

Hand Finishing

AND REALODINE AS PER PAR09-043

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

190

0.00

Powdercoat

Memo

Powder Coating

START TIME: 3:25
OVEN TEMPERATURE: 320°
FINISH TIME: 3:55

QC3- Inspect Part Finish

0.00

200

0.00

OC

Memo

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

Work Order ID 132129

Tuesday, April 28, 2015 9:24:34 AM

132129

Page 7

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 4/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 5/8/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	HandFinishing	0.00							
230									
HandFinish	Memo	0.01							
Hand Finishing	1-Install Inserts as per Dwg								
240	QC5- Inspect part completeness to step on W/O	0.00							
240									
QC	Memo	0.00							
Quality Control									
250	Identify as per dwg & Stock Location: <u>W/O</u>	0.00							
250									
Packaging	Memo	0.01							
Packaging									

DAC
38
9-89

JUN 17 2015

0412-742-043/0130830 1x d JLP 15/06/16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																
Description Work Order Deviation				Disposition				Completed By																																																															
								Lead hand / Supervisor Approval Verification																																																															
								QC / QA Coordinator Approval																																																															
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Environment ☐</td> <td style="width: 15%;">No Re-verification ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Pressure/Forced ☐</td> <td style="width: 15%;">Temperature/Cure ☐</td> <td style="width: 15%;">Power Loss/Surge ☐</td> <td style="width: 15%;">Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
OTHER :																																																																							

Work Order ID 132129***132129***

Page 8

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 4/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/8/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

260

QC21- Final Inspection - Work Order Release

0.00

260

QC

Memo

0.00

Quality Control

JUN 18 2015

MLJ

WIS-0619

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			

Picklist Print

Tuesday, April 28, 2015 9:24:33 AM

Page 1

Work Order ID: 132129

132129

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 4/28/2015

Required Date: 5/8/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20New Issue KJ/EC
 IPP B06.02.10ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100		Manufactured	No			100	Each	37.0000	1	1			
D2500-1-100									**				
Skidtube Extrusion													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				HALL				37					
				86065				37					
D3389-1		Manufactured	No			140	Each	4.0000	1	1			
D3389-1									**				
Web													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG002				4					
				129744				4					
D3681-1		Manufactured	No			160	Each	29.0000	5	5			
D3681-1									**				
Spacer													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG				11					
				129061				11					
				LG001				18					
				123088				5					
				129988				13					

DP 15-4-30

1

DBL 15-5-27

1

**AK150528
B131926 *5**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			

Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐				

Picklist Print

Page 2

Tuesday, April 28, 2015 9:24:33 AM

Work Order ID: 132129

132129

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 4/28/2015

Required Date: 5/8/2015

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130

AELS4-1032-130

Purchased

No

230

Each

670.0000

20

20

AI S4-1032-130

HL 13/06/16

Rivnut

Location

Loc Qty

Loc Code

CA

660

HL 132313

420

M128649

660

st549

10

110511

10

D3591-1 (M127066 (x2) HL 13/06/16

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																	
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																	
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																	
Large Fab ☐	Composite ☐	Supplier ☐																																																																		
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																
Description Work Order Deviation		Disposition		Completed By																																																																
				Lead hand / Supervisor Approval Verification																																																																
				QC / QA Coordinator Approval																																																																
Root Cause <table style="width:100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%; border: none;"> <tr> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>			Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																			
Design ☐	Operator ☐																																																																			
Doc/Data ☐	Offset/Setup ☐																																																																			
Equip/Tooling ☐	Supplier ☐																																																																			
Handling/Pre ☐	Training ☐																																																																			
Material ☐	Use for Testing ☐																																																																			
Internal Transport ☐	Poor Information ☐																																																																			
Tribal Knowledge ☐	Rushing ☐																																																																			
LOA ☐	Product Improvement ☐																																																																			
Substation ☐	Process Improvement ☐																																																																			
Past Expiry Date ☐	Manufacturing Process ☐																																																																			
Misidentified ☐	Past Due ☐																																																																			
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																	
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																	
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																	
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																	
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																	
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																	
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																	
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																	
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																	
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																	
		OTHER : ☐																																																																		

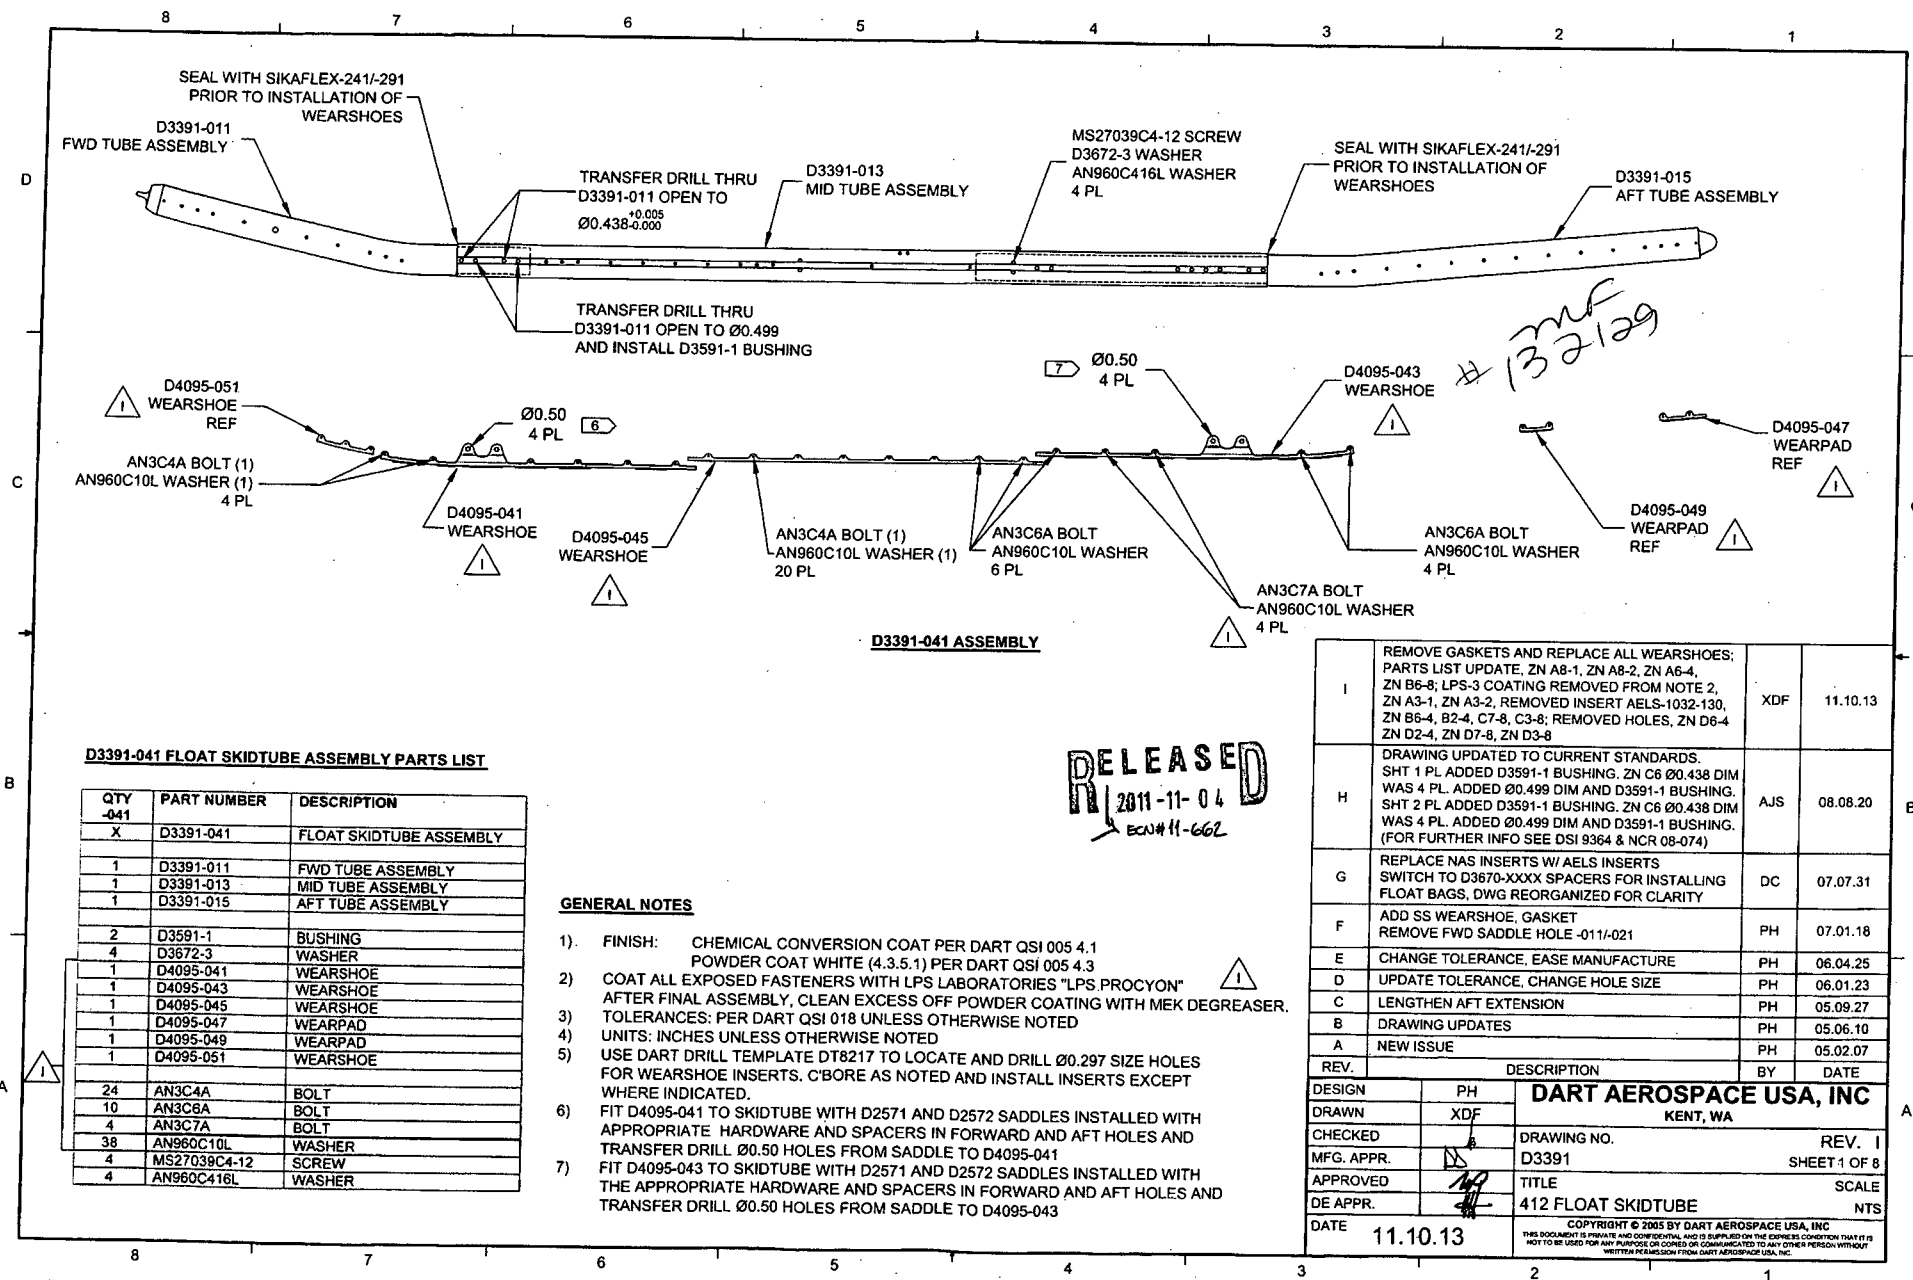

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3391-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARSHOE
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04
ECN# 11-662

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3391-1 BUSHING, ZN C6 Ø.438 DIM WAS 4 PL. ADDED Ø.499 DIM AND D3391-1 BUSHING. SHT 2 PL ADDED D3391-1 BUSHING, ZN C6 Ø.438 DIM WAS 4 PL. ADDED Ø.499 DIM AND D3391-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

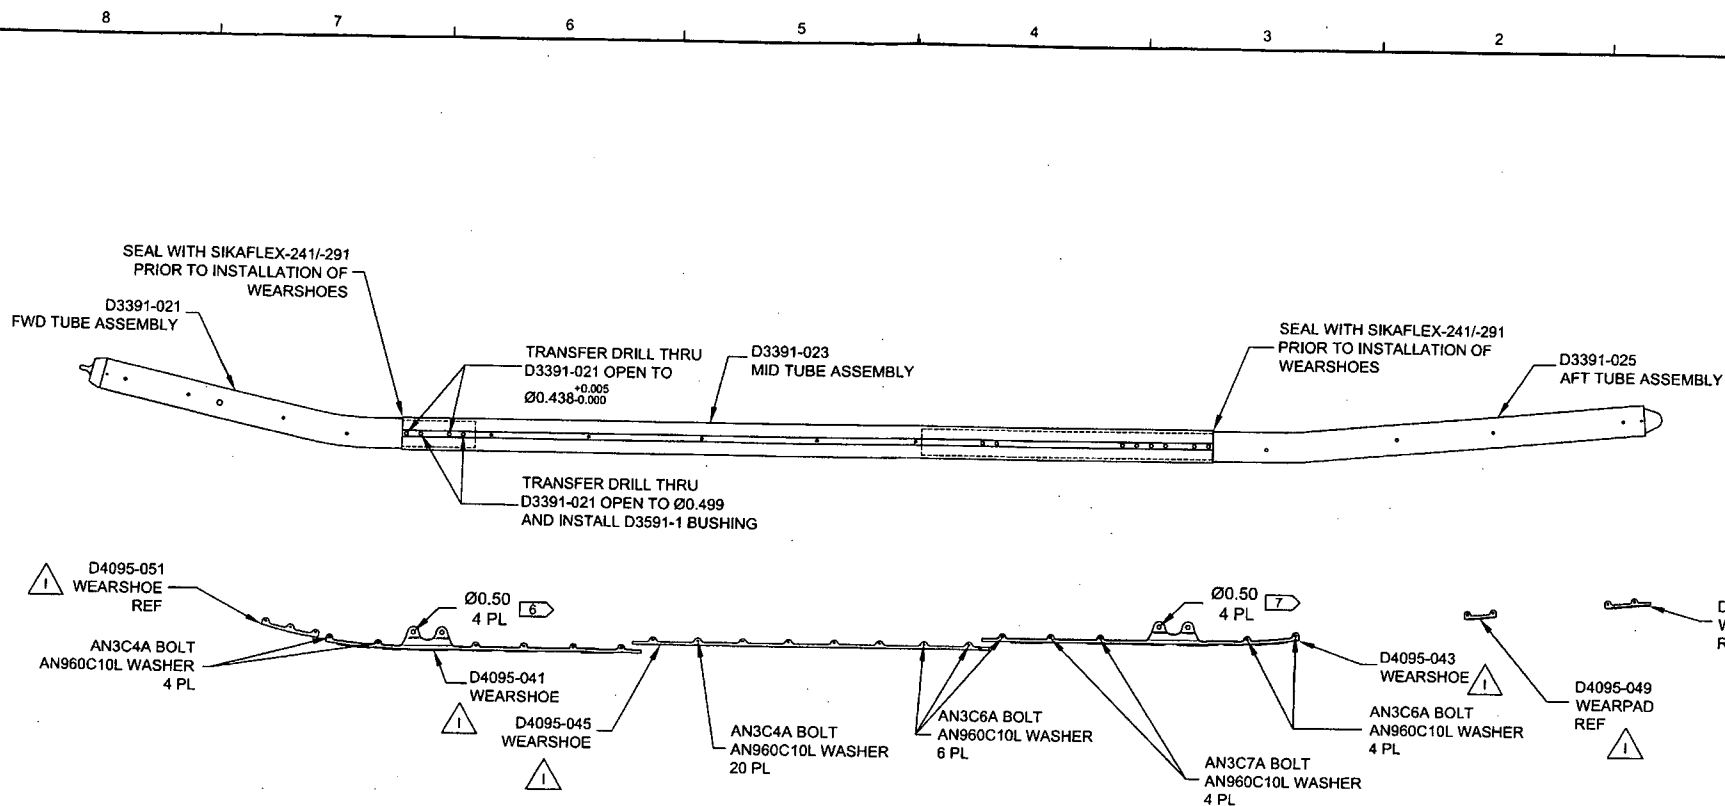

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -043	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV.
MFG. APPR.		D3391	SHEET 2 OF
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NT
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong																				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions																				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance																				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect																				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing																				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved																				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing																				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish																				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread																				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence																				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER :																							
Misidentified ☐	☐ Past Due																								

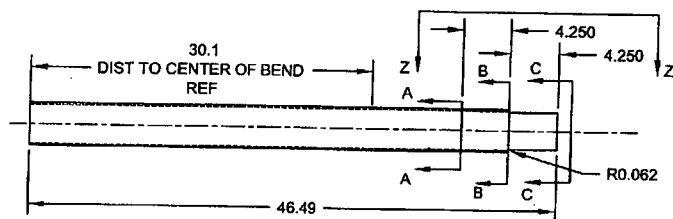


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

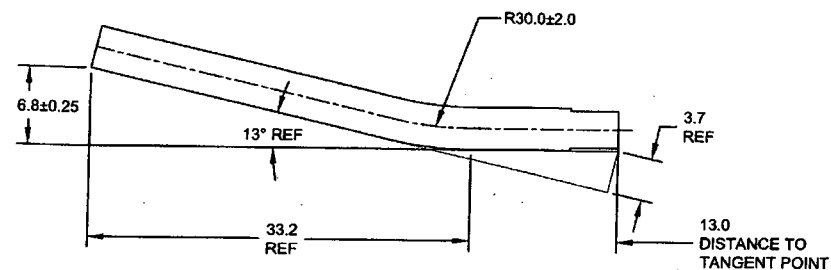


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

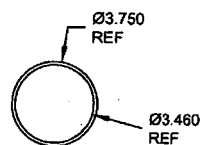


SECTION A-A
SCALE 2X

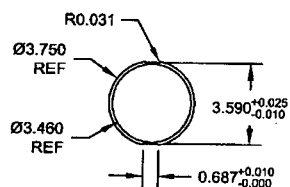

SECTION B-B
SCALE 2X

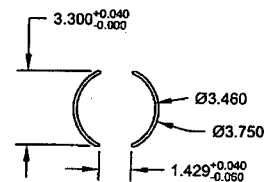

SECTION C-C
SCALE 2X

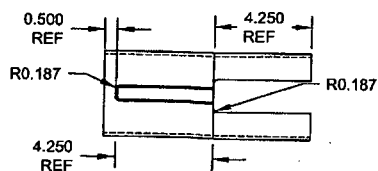

VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV.
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

DQA: _____ Date: _____







WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																		
Large Fab ☐	Composite ☐	Supplier ☐																																																																			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval																																																																	
Description Work Order Deviation			Disposition																																																																		
					Completed By																																																																
					Lead hand / Supervisor Approval Verification																																																																
					QC / QA Coordinator Approval																																																																
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> </tr> </table>			Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>			Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																				
Design ☐	Operator ☐																																																																				
Doc/Data ☐	Offset/Setup ☐																																																																				
Equip/Tooling ☐	Supplier ☐																																																																				
Handling/Pre ☐	Training ☐																																																																				
Material ☐	Use for Testing ☐																																																																				
Internal Transport ☐	Poor Information ☐																																																																				
Tribal Knowledge ☐	Rushing ☐																																																																				
LOA ☐	Product Improvement ☐																																																																				
Substation ☐	Process Improvement ☐																																																																				
Past Expiry Date ☐	Manufacturing Process ☐																																																																				
Misidentified ☐	Past Due ☐																																																																				
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																		
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																		
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																		
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																		
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																		
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																		
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																		
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																		
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																		
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																		
			OTHER :																																																																		

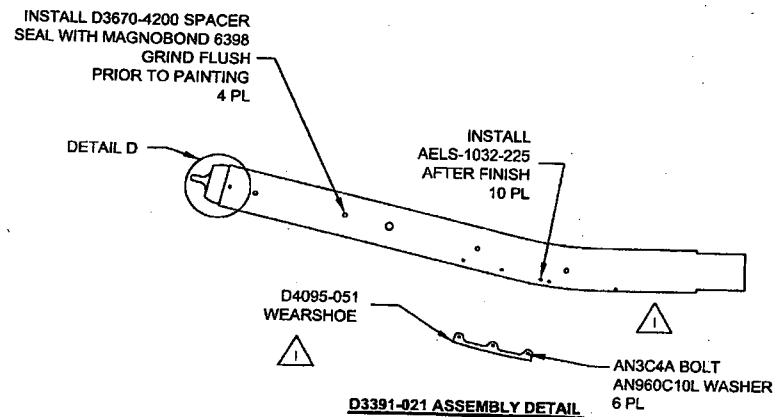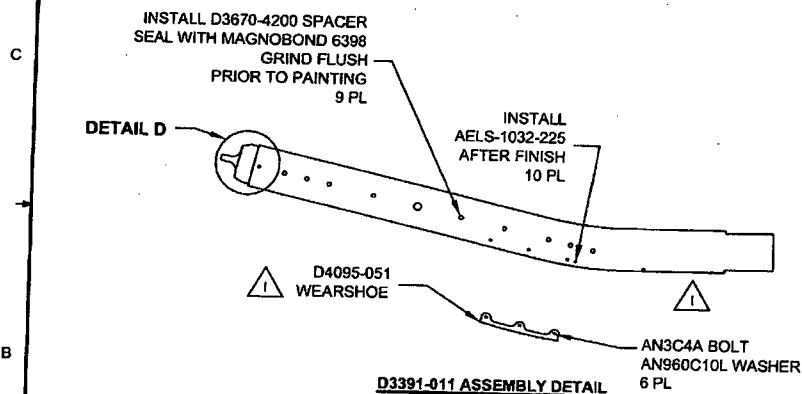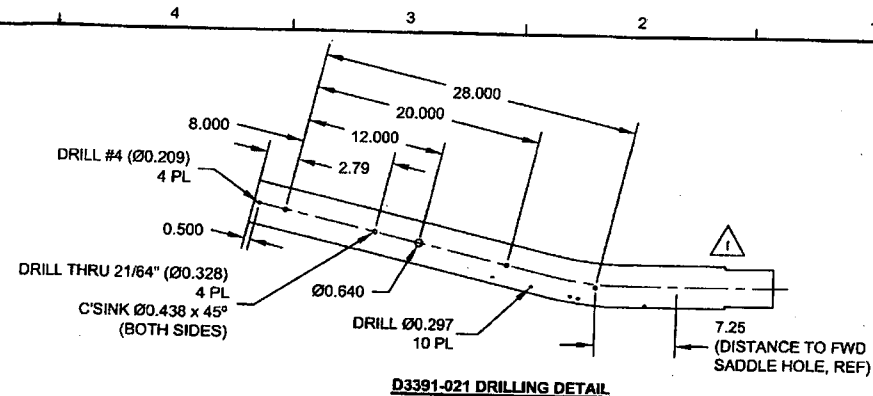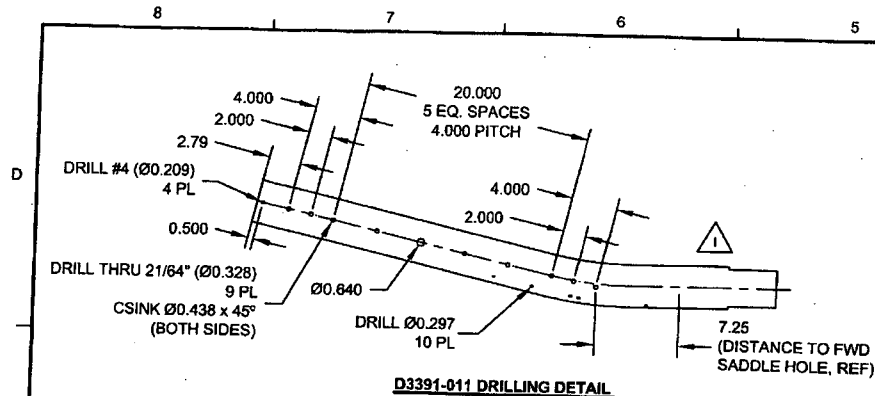

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X	X	D3391-011	FWD TUBE ASSEMBLY
		D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT

SEAL WITH
SIKAFLEX-241/-291

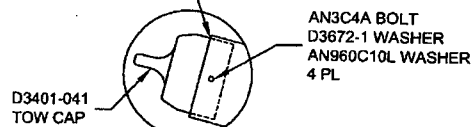

**DETAIL D
SCALE 2X**

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						


8 7 6 5 4 3 2 1

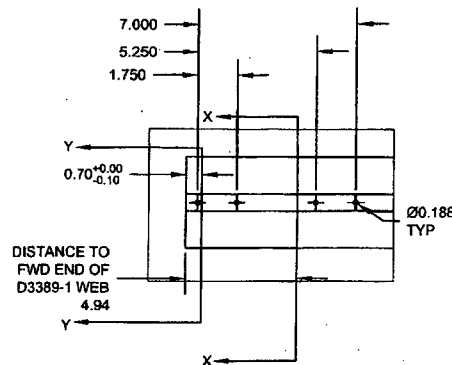

DETAIL J
SCALE 4X

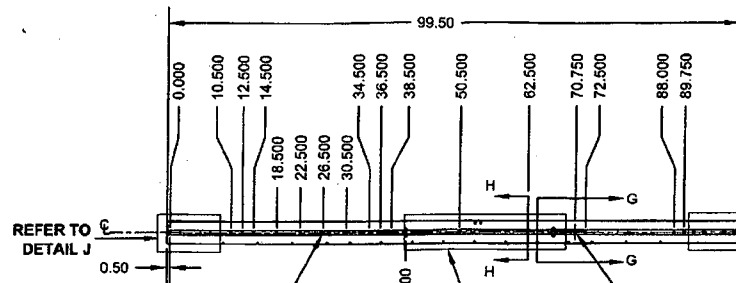


D3391-013 ASSEMBLY DETAIL

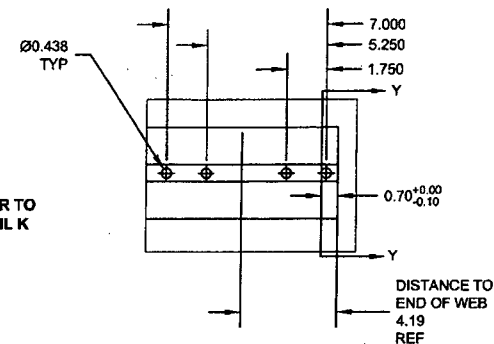


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

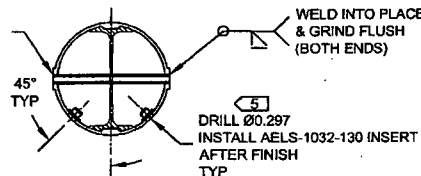

SECTION H-H
SCALE 5X

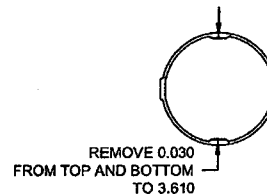


SECTION X-X
SCALE 5X

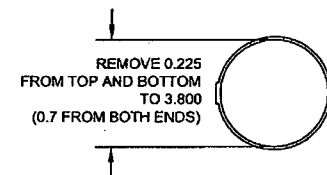


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

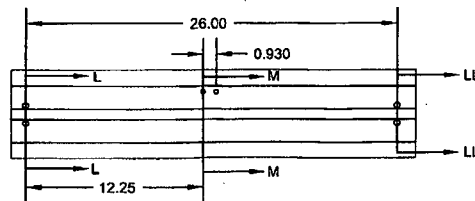


DETAIL E
SCALE NONE

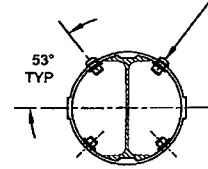

SECTION M-M
SCALE 5X

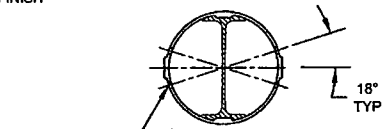

SECTION LL-LL
SCALE 5X

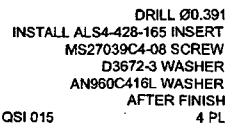


SECTION L-L
SCALE 5X

RELEASED
2011-11-04


D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

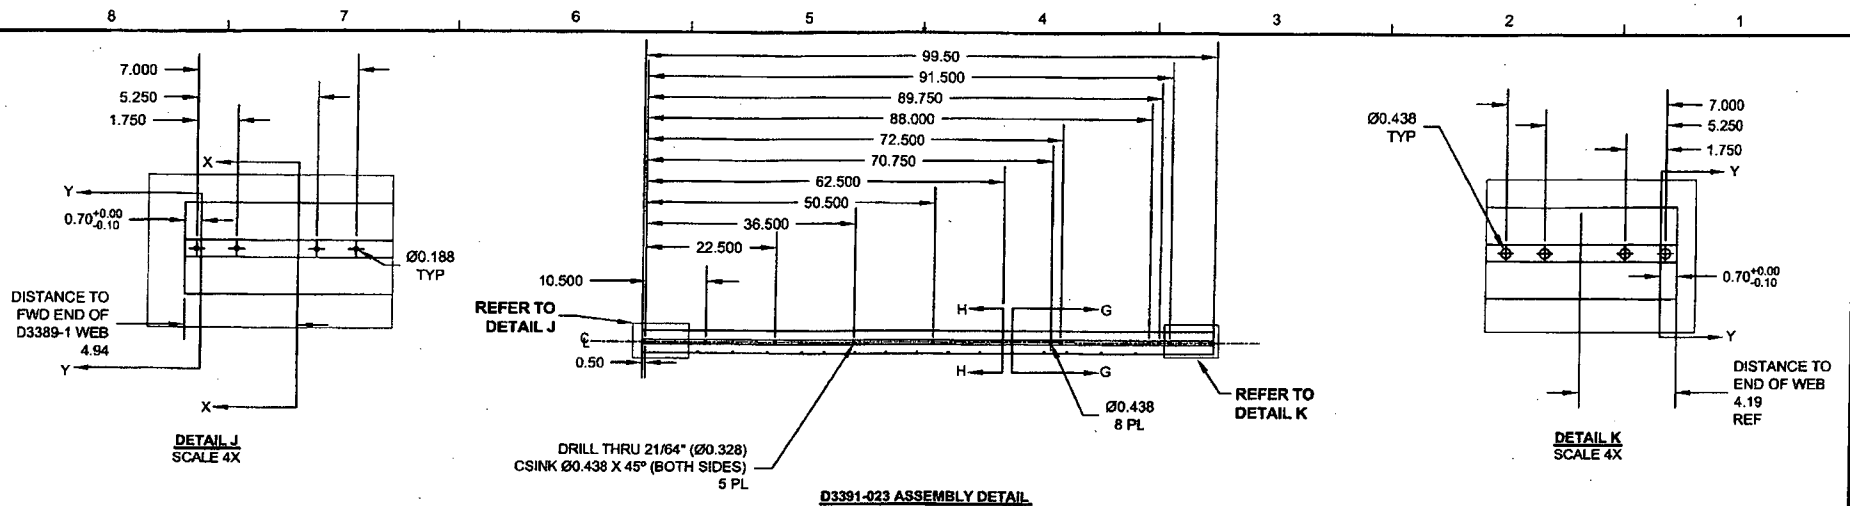


SECTION G-G
SCALE 5X

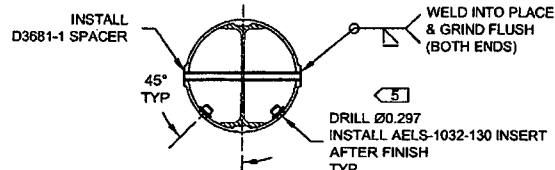

SECTION H-H
SCALE 5X

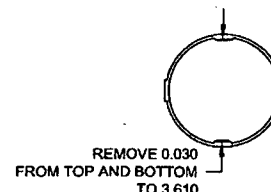

SECTION X-X
SCALE 5X

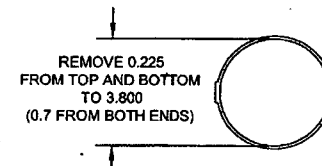

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST


QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO. D3391	REV. 1
MFG. APPR.		SHEET 6 OF 8	
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

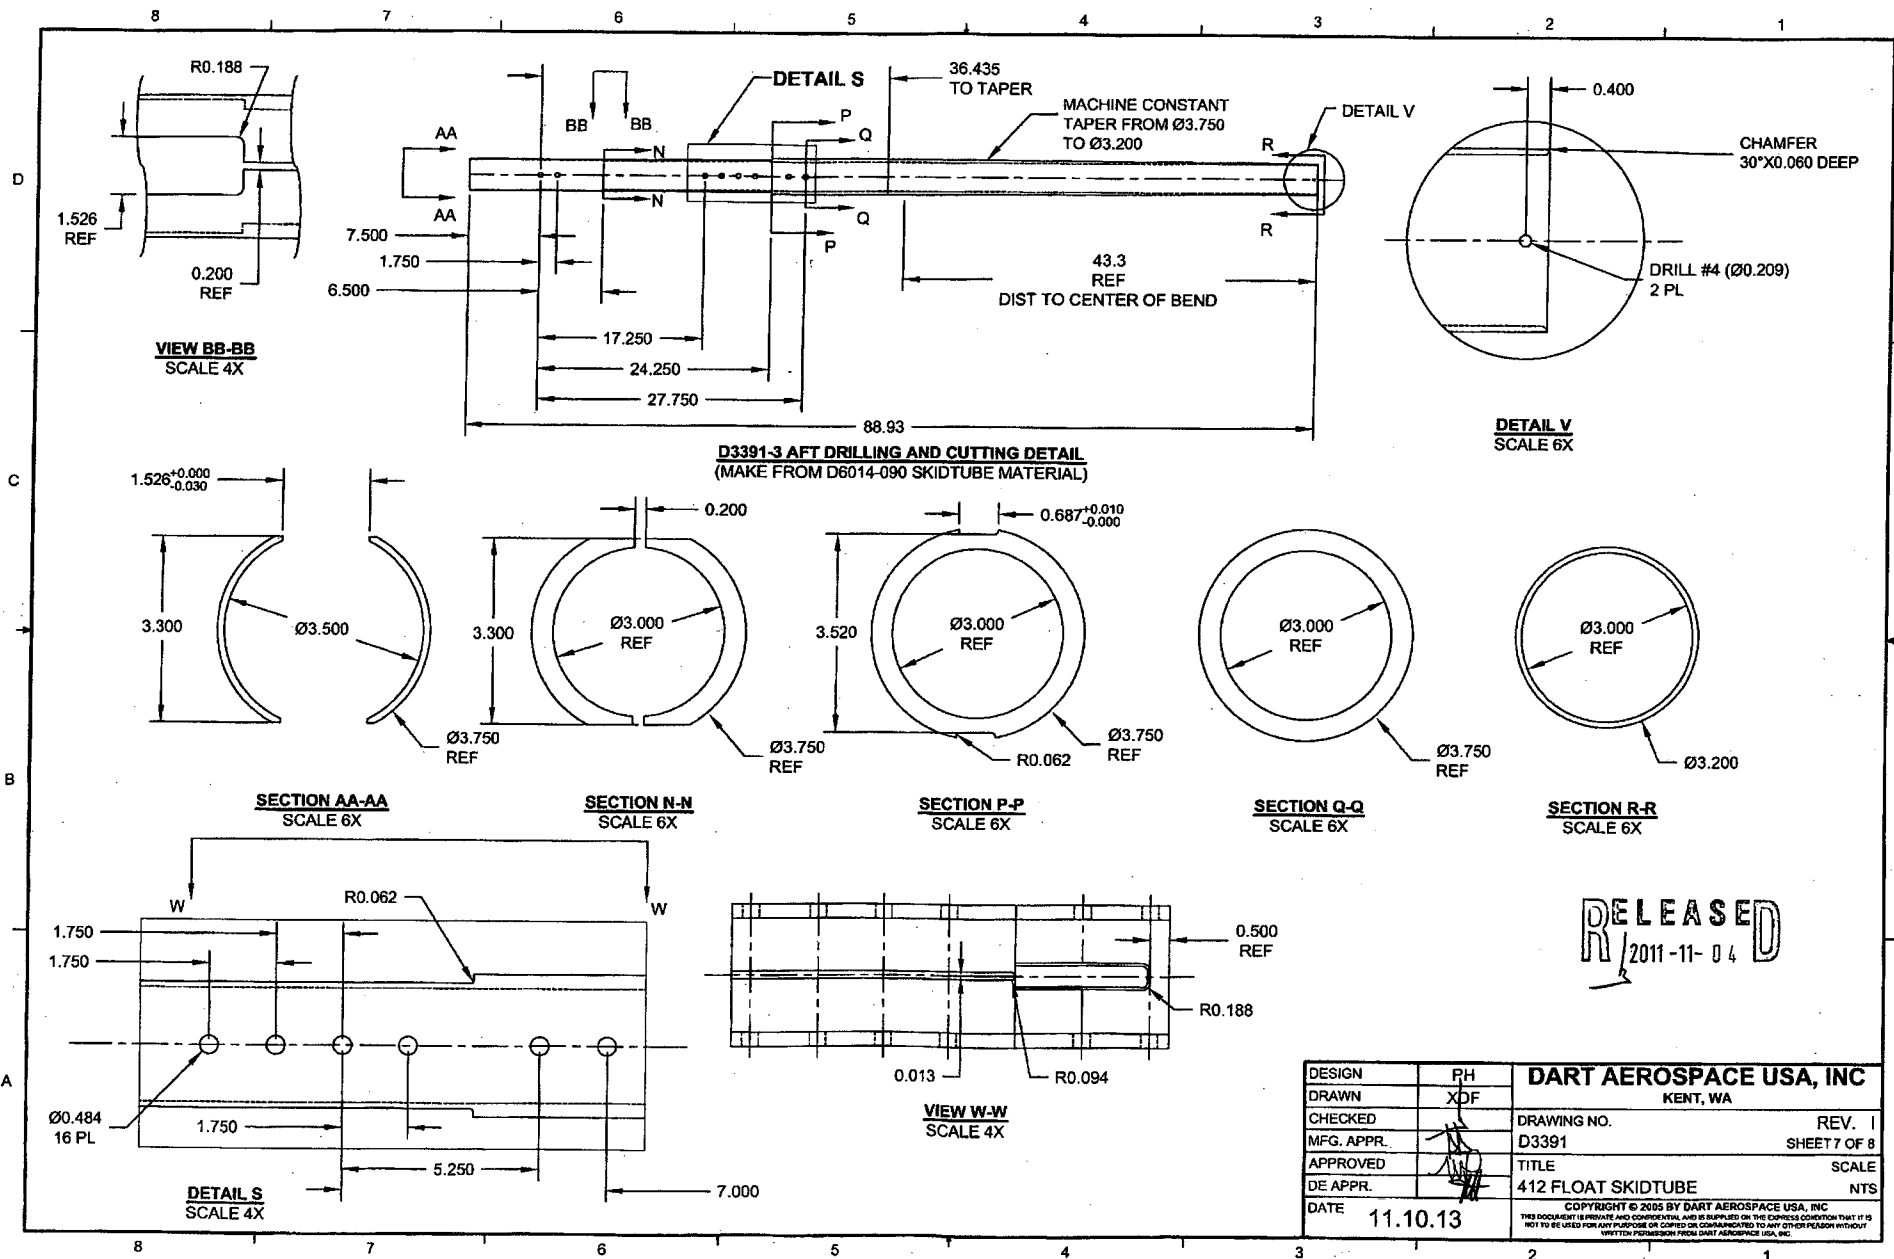

RELEASED
2011-11-04

DESIGN	RH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO. D3391	REV. 1
MFG. APPR.			SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

